

AD-A151 884

FIRE PIT TESTS OF BLUE FLIGHT COVERALL PROGRAM(U) NAVAL 1/1

AIR DEVELOPMENT CENTER WARMINSTER PA AIRCRAFT AND CREW


SYSTEMS TECHNOLOGY DIRECTORATE G KYDD ET AL NOV 83


UNCLASSIFIED

NADC-83118-60

F/G 15/5

NL

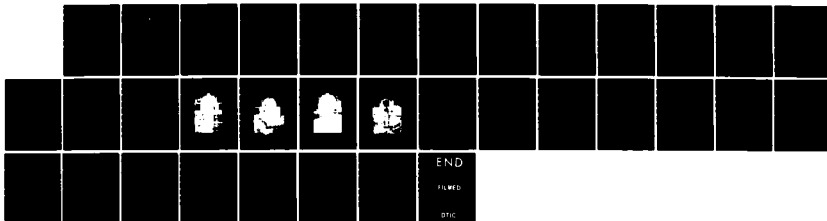

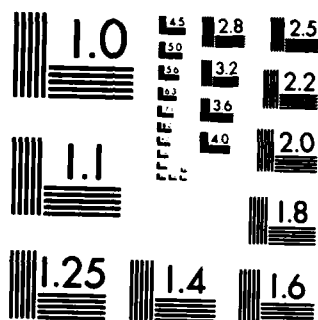

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A

REPORT NO. NADC-83118-60




# **FIRE PIT TESTS OF BLUE FLIGHT COVERALL PROGRAM**

George Kydd and Joan C. Marano  
Aircraft and Crew Systems Technology Directorate  
NAVAL AIR DEVELOPMENT CENTER  
Warminster, Pennsylvania 18974

Lenaud Boutin  
NAVAL CLOTHING AND TEXTILE RESEARCH FACILITY  
Natick, Massachusetts 01760

**NOVEMBER 1983**

FINAL REPORT

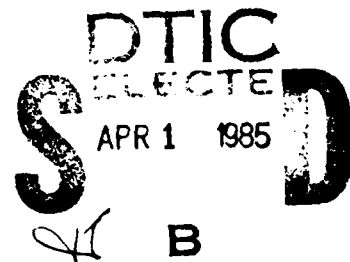

*Approved for Public Release, Distribution Unlimited*

Prepared For  
NAVAL CLOTHING AND TEXTILE RESEARCH FACILITY  
Natick, Massachusetts 01760

**85 03 13 218**

**AD-A151 884**

**DTIC FILE COPY**


## NOTICES

**REPORT NUMBERING SYSTEM** — The numbering of technical project reports issued by the Naval Air Development Center is arranged for specific identification purposes. Each number consists of the Center acronym, the calendar year in which the number was assigned, the sequence number of the report within the specific calendar year, and the official 2-digit correspondence code of the Command Office or the Functional Directorate responsible for the report. For example: Report No. NADC-78015-20 indicates the fifteenth Center report for the year 1978, and prepared by the Systems Directorate. The numerical codes are as follows:

CODE	OFFICE OR DIRECTORATE
00	Commander, Naval Air Development Center
01	Technical Director, Naval Air Development Center
02	Comptroller
10	Directorate Command Projects
20	Systems Directorate
30	Sensors & Avionics Technology Directorate
40	Communication & Navigation Technology Directorate
50	Software Computer Directorate
60	Aircraft & Crew Systems Technology Directorate
70	Planning Assessment Resources
80	Engineering Support Group

**PRODUCT ENDORSEMENT** — The discussion or instructions concerning commercial products herein do not constitute an endorsement by the Government nor do they convey or imply the license or right to use such products.

APPROVED BY: \_\_\_\_\_

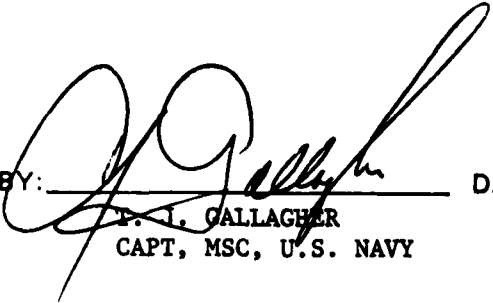  
P. L. GALLAGHER  
CAPT, MSC, U.S. NAVY

DATE: \_\_\_\_\_

6 Nov 1984

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NADC-83118-60	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle)  Fire Pit Tests of Blue Flight Coverall Program		5. TYPE OF REPORT & PERIOD COVERED Final Report
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s)  George H. Kydd and Joan C. Morano		8. CONTRACT OR GRANT NUMBER(s)
9. PERFORMING ORGANIZATION NAME AND ADDRESS Naval Air Development Center Aircraft & Crew Systems Technology Warminster, PA 18974		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS  Directorate
11. CONTROLLING OFFICE NAME AND ADDRESS Naval Clothing Textile Research Facility 21 Strathmore Road Natick, Mass. 01760		12. REPORT DATE November 1983
		13. NUMBER OF PAGES 20
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. SECURITY CLASS. (of this report)  Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)  Approved for Public Release; Distribution Unlimited		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)  Blue Flight Coverall, Fire Pit Tests		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number)  Twelve test garments of the Blue Flight Coverall Program were tested for fire protection in the NADC Fuel Fire Test Facility. Manikins with their surfaces sensorred for temperature and dressed in the Coverall were passed through the flames fueled by JP-4 for two second intervals. The mean percentage body burned was 26.83% with a range of 4.0 to 49.5%. These results are discussed in terms of the total "system of protection" available to the fully clothed airman.		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE  
S/N 0102-LF-014-6601

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

NADC-83118-60

TABLE OF CONTENTS

	Page No.
LIST OF TABLES.....	ii
LIST OF FIGURES.....	ii
INTRODUCTION.....	1
METHOD.....	1
RESULTS.....	2
DISCUSSION.....	2



Accession For	
NTIS	<input checked="checked" type="checkbox"/>
DTIC	<input type="checkbox"/>
Unpublished	<input type="checkbox"/>
JPRS	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

LIST OF TABLES

Table No.	Title	Page No.
I	Sensor Sites .....	3
II	Accumulated Run Data .....	4
III	Percent Body Burned at 250F .....	8
IV	Heat Flux and Total Percent Body Burned .....	9
V	Blue Nomex Flight Coverall Flaming Results .....	10

LIST OF FIGURES

Figure No.	Title	Page No.
1	Blue Nomex Flight Coverall (front, before) .....	11
2	Blue Nomex, Flight Coverall (front, after) .....	12
3	Blue Nomex Flight Coverall (back, before) .....	13
4	Blue Nomex Flight Coverall (back, after) .....	14

## BLUE FLIGHT COVERALL - FIRE PROTECTION

The Blue Flight Coverall Program has been described previously (1), as providing a supplement to the present sage green CWU-27/P Coverall which is worn as an outer garment with various protection under - garments. The Blue Flight Coverall would be worn on certain missions, as desired by the Squadron Commanding Officer. The tests to be described are concerned specifically with the fire protection of Blue (Nomex) Flight Coverall (BNFC) in the situation of the open fuel fire.

## METHOD

The tests were carried out at the NADC Fuel Fire Test Facility by procedures that have been described previously (2). A manikin dressed in the BNFC was carried through the flames on a rotary crane that has a two second traverse over the fire pit. The fire pit measures 20' x 30' and is 8" deep. It is filled with water to just below the height of a grid of aluminum angle that divides the surface into 20 cells. Each cell has a fuel nozzle through which fuel is pumped. The procedure is that fuel is pumped, it rises to the surface, and spreads in the cells. About 20 seconds later it is ignited and the flames allowed to reach maximum height, temperature and sound, when the manikin is sent through. The operation is controlled from behind a concrete block wall so that the passage through the flames is not seen by the operators. The fuel was JP-4.

The manikins were dressed in summer underwear, shorts and T-shirt, and the Blue Nomex Flight Coverall. The manikin surface was provided with 26 sensor sites containing seven sensor strips each by which the temperature was measured. These strips were fabricated to change color at the temperature printed on its face. The temperatures were 220, 230, 240, 250, 260, 270, and 280 degrees F and they were mounted on leather patches that were placed at the 26 sites. These sites are shown in Table I and were distributed ten to the torso, eight to the arms and eight to the legs, a distribution that covers 81% of the total body surface.

Heat flux was measured by a transducer that was carried through the flames at the manikins' waist and the signal was printed on a strip chart recorder. The heat flux was obtained by integrating the trace with a planimeter.

Viewing the emergence of the manikin from the flames beyond the wall are two movie cameras. One running at normal speed (24 frames/sec) has a 50mm focal length lens so that it gives a closeup of the manikin. The other camera has a 10mm lens and it runs at slow motion speed (100 frames/sec). A hand-held TV camera picked up the manikin as it came from behind the wall. The manikin is then viewed front, back and side by the TV camera, zooming in and out for detail (focal length 11mm-70mm). Still photographs were also made of these views at this time. Still photographs and TV views are also made of front, back and side of the dressed manikin before the exposure. All cameras are slated with an identifying test number which contains eleven digits and is coded as follows:

XXXX  
Identifying Code

XXXX  
Julian Date

XXX  
Serial Number

The percentage body burned was calculated based on data for the division of body surface by Hardy (3). The data allocates 35% of the body surface to the torso and since there were ten sensors on the torso in these tests, each would be worth 35/10, or 3.5% of the body surface. In the same manner, the arms having eight sensors are allocated 14%, therefore 14/8 or 1.75% for each arm sensor and the legs having eight sensors are allocated 32%, and 32/8 or 4% for a leg sensor. In these tests the sensors were evaluated at 250 degrees F for a third degree burn.



## RESULTS

The sensor data are shown in Table II. Sites are represented by rows with the seven temperatures. If a sensor got hot enough to be triggered (changes color) the temperature is written out, if not a zero appears. Heat flux in Cal/cm appears on the line with the identification. The results of calculations for percentage body burned for the three body areas, torso, arms and legs and the total for each test are shown in Table III. The total body burned along with the flux is shown in Table IV. Observations from the photography and TV coverage are shown in Table V. Figures 1 and 3 show the front and back views respectively, of the Blue Flight Coverall uniform before the fire tests. Figure 2 shows the front view of the Blue Flight Coverall after passing through the 2 sec fuel fire. Similarly, Figure 4 shows the back view of the coverall after the test. The beige patches indicate the areas affected by the heat.

## DISCUSSION

As shown by the movie footage, all but one of the suits was flaming as it emerged from the pit and all quickly self-extinguished, but smoked for next few seconds. The heat caused a dramatic color change from Royal Blue to light beige. Thus it was possible to visually determine those parts of the suit that were heated. Although the light beige progressed to a darker beige when ashing took place, the first color change seemed not to have affected the integrity of the material as indicated by its resistance to ripping by hand. It was not possible to tear it in the light beige state. In the next stage, darker beige, it was brittle and would disintegrate with light squeezing. (This ashing was limited to small areas of some of the coveralls in these tests). This observation raises the question as to what was burning in the flaming and since the fabric appears unaffected and the dye is absent, the implication is that it well may be the dye.

The mean of percent body burned at 250 degrees F for the 12 flight suits was 26.83, with a range of 4.0 to 49.5. The suit would offer average if not desirable protection from fuel fires. The flight suit is only one part of the overall protection from fire that the airman wears. Since it is usually covered by any number of additional pieces of equipment and outer garment the actual protection would be the result of the entire "system of protection" which would certainly be greater than that offered by the suit alone. The percentage body burned of the clothing assemblies drawn in the 6.7 manual (NAVAIR 13-1-6.7) would be a proper approach to the question of how much protection the airman has with this or any flight coverall.

TABLE I. SENSOR SITES

Current

1. UT2F Upper Torso 2 Front, left breast
2. UT2B Upper Torso 2 Back
3. UT3F Upper Torso 3 Front, right breast
4. UT3B Upper Torso 3 Back
5. UT6F Upper Torso 6 Front, naval
6. UT6B Upper Torso 6 Back
7. LT1F Lower Torso 1 Front, pelvic area right
8. LT1B Lower Torso 1 Back
9. LT2F Lower Torso 2 Front, pelvic area left
10. LT2B Lower Torso 2 Back
11. RA1F Right Arm Upper 1 Front
12. RA1B Right Arm Upper 1 Back
13. RA2F Right Arm Lower 2 Front
14. RA2B Right Arm Lower 2 Back
15. LA1F Left Arm Upper 1 Front
16. LA1B Left Arm Upper 1 Back
17. LA2F Left Arm Lower 2 Front
18. LA2B Left Arm Lower 2 Back
19. RL1F Right Leg 1 Front, thigh
20. RL1B Right Leg 1 Back
21. RL3F Right Leg 3 Front, lower leg
22. RL3B Right Leg 3 Back
23. LL1F Left Leg 1 Front, thigh
24. LL1B Left Leg 1 Back
25. LL3F Left Leg 3 Front, lower leg
26. LL3B Left Leg 3 Back

TABLE II. ACCUMULATED RUN DATA

BNFC3263249		2 SEC		4.64CAL/CM2		BNFC3263250		2 SEC		9.07CAL/CM2		BNFC3263251		2 SEC		5.20CAL/CM2	
UT2F		0	0	0	0	UT2F		0	0	0	0	UT2F		0	0	0	0
UT2B		0	0	0	0	UT2B		0	0	0	0	UT2B		0	0	0	0
UT3F		0	0	0	0	UT3F		0	0	0	0	UT3F		0	0	0	0
UT3B		0	0	0	0	UT3B		0	0	0	0	UT3B		0	0	0	0
UT6F		0	0	0	0	UT6F		0	0	0	0	UT6F		0	0	0	0
UT6B		0	0	0	0	UT6B		0	0	0	0	UT6B		0	0	0	0
LT1F		0	0	0	0	LT1F		0	0	0	0	LT1F		0	0	0	0
LT1B		0	0	0	0	LT1B		0	0	0	0	LT1B		0	0	0	0
LT2F		0	0	0	0	LT2F		0	0	0	0	LT2F		0	0	0	0
LT2B		0	0	0	0	LT2B		0	0	0	0	LT2B		0	0	0	0
RA1F		220	270	240	250	RA1F		220	230	240	250	RA1F		220	230	240	250
RA1B		0	0	0	0	RA1B		0	0	0	0	RA1B		0	0	0	0
RA2F		220	270	240	250	RA2F		220	230	240	250	RA2F		220	230	240	250
RA2B		0	0	0	0	RA2B		0	0	0	0	RA2B		0	0	0	0
LA1F		0	0	0	0	LA1F		0	0	0	0	LA1F		0	0	0	0
LA1B		0	0	0	0	LA1B		0	0	0	0	LA1B		0	0	0	0
LA2F		220	270	240	250	LA2F		220	230	240	250	LA2F		220	230	240	250
LA2B		0	0	0	0	LA2B		0	0	0	0	LA2B		0	0	0	0
RL1F		220	270	240	250	RL1F		220	230	240	250	RL1F		220	230	240	250
RL1B		0	0	0	0	RL1B		0	0	0	0	RL1B		0	0	0	0
RL3F		0	0	0	0	RL3F		0	0	0	0	RL3F		0	0	0	0
RL3B		220	270	240	250	RL3B		220	230	240	250	RL3B		220	230	240	250
LL1F		0	0	0	0	LL1F		0	0	0	0	LL1F		0	0	0	0
LL1B		0	0	0	0	LL1B		220	230	240	250	LL1B		220	230	240	250
LL3F		0	0	0	0	LL3F		220	230	240	250	LL3F		220	230	240	250
LL3B		220	270	240	250	LL3B		220	230	240	250	LL3B		220	230	240	250

THE SEVEN NUMBERED COLUMNS REPRESENT THE SEVEN SENSORS AT EACH SITE IF 7600 ITS TEMPERATURE WAS NOT REACHED

UT UPPER TORSO  
LT LOWER TORSO  
RA RIGHT ARM  
LA LEFT ARM  
PL RIGHT LEG  
LL LEFT LEG  
F FRONT  
R BACK

TABLE II. ACCUMULATED RUN DATA (Continued)

BNFC3263252				BNFC3263253				BNFC3263254			
2 SEC				2 SEC				2 SEC			
4 49FAL/CM2				5 08CAL/CM2				7 36FAL/CM2			
TORSO				TORSO				TORSO			
UT2F	0	0	0	UT2F	0	0	0	UT2F	220	230	0
UT2B	0	0	0	UT2B	220	230	0	UT2B	220	230	0
UT3F	220	230	0	UT3F	0	0	0	UT3F	220	230	0
UT3B	0	0	0	UT3B	220	230	0	UT3B	220	230	0
UT6F	0	0	0	UT6F	0	0	0	UT6F	0	0	0
UT6B	0	0	0	UT6B	0	0	0	UT6B	0	0	0
LT1F	0	0	0	LT1F	0	0	0	LT1F	0	0	0
LT1B	0	0	0	LT1B	0	0	0	LT1B	0	0	0
LT2F	0	0	0	LT2F	0	0	0	LT2F	0	0	0
LT2B	0	0	0	LT2B	0	0	0	LT2B	0	0	0
ARMS				ARMS				ARMS			
RA1F	0	0	0	RA1F	220	230	240	RA1F	220	230	240
RA1B	0	0	0	RA1B	0	0	0	RA1B	220	230	240
RA2F	220	230	240	RA2F	0	0	0	RA2F	220	230	240
RA2B	220	230	240	RA2B	220	230	240	RA2B	220	230	240
LA1F	0	0	0	LA1F	220	230	240	LA1F	220	230	240
LA1B	0	0	0	LA1B	220	230	240	LA1B	220	230	240
LA2F	220	230	240	LA2F	220	230	240	LA2F	220	230	240
LA2B	220	230	240	LA2B	220	230	240	LA2B	220	230	240
LEGS				LEGS				LEGS			
RL1F	220	230	240	RL1F	0	0	0	RL1F	220	230	240
RL1B	0	0	0	RL1B	0	0	0	RL1B	220	230	240
RL3F	220	230	240	RL3F	220	230	240	RL3F	220	230	240
RL3B	220	230	240	RL3B	220	230	240	RL3B	220	230	240
LL1F	220	230	240	LL1F	0	0	0	LL1F	220	230	240
LL1B	0	0	0	LL1B	220	230	240	LL1B	220	230	240
LL3F	220	230	240	LL3F	220	230	240	LL3F	220	230	240
LL3B	220	230	240	LL3B	220	230	240	LL3B	220	230	240

THE SEVEN NUMBERED COLUMNS REPRESENT THE SEVEN SENSORS AT EACH SITE IF ZERO, ITS TEMPERATURE WAS NOT REACHED

UT UPPER TORSO  
 LT LOWER TORSO  
 RA RIGHT ARM  
 LA LEFT ARM  
 RL RIGHT LEG  
 LL LEFT LEG  
 F FRONT  
 B BACK

TABLE II. ACCUMULATED RUN DATA (Continued)

BNFC3263255				BNFC3261256				BNFC3263257			
2 SEC				2 SEC				2 SEC			
5.85CAL/CM2				7.53CAL/CM2				7.1/CM2			
TORSO				TORSO				TORSO			
UT2F	0	0	0	UT2F	0	0	0	UT2F	0	0	0
UT2B	0	0	0	UT2B	0	0	0	UT2B	0	0	0
UT3F	0	0	0	UT3F	0	0	0	UT3F	0	0	0
UT3B	0	0	0	UT3B	0	0	0	UT3B	0	0	0
UT6F	0	0	0	UT6F	0	0	0	UT6F	0	0	0
UT6B	0	0	0	UT6B	0	0	0	UT6B	0	0	0
LT1F	0	0	0	LT1F	0	0	0	LT1F	0	0	0
LT1B	0	0	0	LT1B	0	0	0	LT1B	0	0	0
LT2F	0	0	0	LT2F	0	0	0	LT2F	0	0	0
LT2B	0	0	0	LT2B	0	0	0	LT2B	0	0	0
ARMS				ARMS				ARMS			
RA1F	220	230	240	RA1F	220	230	240	RA1F	220	230	240
RA1B	220	230	240	RA1B	220	230	240	RA1B	220	230	240
RA2F	220	230	240	RA2F	220	230	240	RA2F	220	230	240
RA2B	220	230	240	RA2B	220	230	240	RA2B	220	230	240
LA1F	220	230	240	LA1F	220	230	240	LA1F	220	230	240
LA1B	220	230	240	LA1B	220	230	240	LA1B	220	230	240
LA2F	220	230	240	LA2F	220	230	240	LA2F	220	230	240
LA2B	220	230	240	LA2B	220	230	240	LA2B	220	230	240
LEGS				LEGS				LEGS			
RL1F	220	230	240	RL1F	220	230	240	RL1F	220	230	240
RL1B	220	230	240	RL1B	220	230	240	RL1B	220	230	240
RL3F	220	230	240	RL3F	220	230	240	RL3F	220	230	240
RL3B	220	230	240	RL3B	220	230	240	RL3B	220	230	240
LL1F	220	230	240	LL1F	220	230	240	LL1F	220	230	240
LL1B	220	230	240	LL1B	220	230	240	LL1B	220	230	240
LL3F	220	230	240	LL3F	220	230	240	LL3F	220	230	240
LL3B	220	230	240	LL3B	220	230	240	LL3B	220	230	240

THE SEVEN NUMBERED COLUMNS REPRESENT THE SEVEN SENSORS AT EACH SITE IF ZERO, ITS TEMPERATURE WAS NOT REACHED.

UT UPPER TORSO  
 LT LOWER TORSO  
 RA RIGHT ARM  
 LA LEFT ARM  
 RL RIGHT LEG  
 LL LEFT LEG  
 F FRONT  
 B BACK

TABLE II. ACCUMULATED RUN DATA (Continued)

BNFC3263258 2 SEC				5.66CAL/CM2				BNFC3263259 2 SEC				9.86CAL/CM2				BNFC3263260 2 SEC				3.45CAL/CM2			
TORSO				TORSO				TORSO				TORSO				TORSO				TORSO			
UT2F	220	230	0	0	0	0	0	UT2F	220	230	240	250	0	0	0	UT2F	0	0	0	0	0		
UT2B	220	230	240	250	260	270	280	UT2B	220	230	240	0	0	0	0	UT2B	0	0	0	0	0		
UT3F	0	0	0	0	0	0	0	UT3F	0	0	0	0	0	0	0	UT3F	0	0	0	0	0		
UT3B	220	230	240	250	260	270	280	UT3B	220	230	240	250	260	270	280	UT3B	0	0	0	0	0		
UT6F	0	0	0	0	0	0	0	UT6F	0	0	0	0	0	0	0	UT6F	0	0	0	0	0		
UT6B	0	0	0	0	0	0	0	UT6B	0	0	0	0	0	0	0	UT6B	0	0	0	0	0		
LT1F	0	0	0	0	0	0	0	LT1F	0	0	0	0	0	0	0	LT1F	0	0	0	0	0		
LT1B	0	0	0	0	0	0	0	LT1B	0	0	0	0	0	0	0	LT1B	0	0	0	0	0		
LT2F	0	0	0	0	0	0	0	LT2F	0	0	0	0	0	0	0	LT2F	0	0	0	0	0		
LT2B	0	0	0	0	0	0	0	LT2B	0	0	0	0	0	0	0	LT2B	0	0	0	0	0		
ARMS				ARMS				ARMS				ARMS				ARMS							
RA1F	220	230	240	250	260	270	0	RA1F	0	0	0	0	0	0	0	RA1F	0	0	0	0	0		
RA1B	220	230	240	250	260	270	0	RA1B	220	230	240	250	260	270	280	RA1B	0	0	0	0	0		
RA2F	220	230	240	250	260	270	0	RA2F	0	0	0	0	0	0	0	RA2F	0	0	0	0	0		
RA2B	220	230	240	250	260	270	280	RA2B	220	230	240	250	260	270	280	RA2B	0	0	0	0	0		
LA1F	220	230	240	0	0	0	0	LA1F	0	0	0	0	0	0	0	LA1F	0	0	0	0	0		
LA1B	0	0	0	0	0	0	0	LA1B	220	230	240	250	260	270	280	LA1B	0	0	0	0	0		
LA2F	220	230	240	250	260	270	280	LA2F	0	0	0	0	0	0	0	LA2F	0	0	0	0	0		
LA2B	0	0	0	0	0	0	0	LA2B	220	230	240	250	260	270	280	LA2B	0	0	0	0	0		
LEGS				LEGS				LEGS				LEGS				LEGS							
RL1F	0	0	0	0	0	0	0	RL1F	220	230	240	0	0	0	0	RL1F	0	0	0	0	0		
RL1B	220	230	240	250	260	270	280	RL1B	220	230	240	250	260	270	280	RL1B	0	0	0	0	0		
RL3F	220	230	240	0	0	0	0	RL3F	220	230	240	250	0	0	0	RL3F	220	230	240	250	0		
RL3B	220	0	0	0	0	0	0	RL3B	220	230	240	0	0	0	0	RL3B	0	0	0	0	0		
LL1F	220	230	240	250	260	270	280	LL1F	220	230	240	250	260	270	280	LL1F	0	0	0	0	0		
LL1B	220	230	240	0	0	0	0	LL1B	220	230	0	0	0	0	0	LL1B	0	0	0	0	0		
LL3F	220	230	240	250	260	270	280	LL3F	220	230	240	250	0	0	0	LL3F	220	230	240	0	0		
LL3B	220	230	240	250	0	0	0	LL3B	0	0	0	0	0	0	0	LL3B	0	0	0	0	0		

TABLE III. PERCENT BODY BURNED AT 250 F

IDENTIFICATION	TESTS BY SOURCE, 26 SITE TESTS					TOTAL
	FLUX	TORSO	ARMS	PERCENT BODY BURNED	LEGS	
BNFC 3263 249	4.64	0.0	3.5	4.0		7.5
BNFC 3263 250	8.07	0.0	8.8	20.0		28.8
BNFC 3263 251	5.29	3.5	5.3	12.0		20.8
BNFC 3263 252	4.49	0.0	7.0	24.0		31.0
BNFC 3263 253	5.08	0.0	3.5	16.0		19.5
BNFC 3263 254	7.36	7.0	10.5	32.0		49.5
BNFC 3263 255	5.85	0.0	12.3	16.0		28.3
BNFC 3263 256	7.53	0.0	10.5	12.0		22.5
BNFC 3263 257	6.72	0.0	8.8	20.0		28.8
BNFC 3263 258	5.65	7.0	8.8	16.0		31.8
BNFC 3263 259	9.86	7.0	7.0	16.0		30.0
BNFC 3263 260	3.45	0.0	0.0	4.0		4.0
MEAN & STD DEV	6.07	1.27				26.83 10.79

TABLE IV. HEAT FLUX AND TOTAL PERCENT BODY BURNED

IDENTIFICATION	FLUX CAL/CM2	% BOD. BURN.	IDENTIFICATION	FLUX CAL/CM2	% BOD. BURN.	IDENTIFICATION	FLUX CAL/CM2	% BOD. BURN.
BNFC3263249	4.64	7.5	BNFC3263250	8.07	28.8	BNFC3263251	5.29	20.8
BNFC3263252	4.49	31.0	BNFC3263253	5.08	19.5	BNFC3263254	7.36	49.5
BNFC3263255	5.85	28.3	BNFC3263256	7.53	22.5	BNFC3263257	6.72	28.8
BNFC3263258	5.66	31.8	BNFC3263259	9.86	30.0	BNFC3263260	3.45	4.0

MEAN &amp; STD DEV OF FLUX 6.07 1.27

MEAN &amp; STD DEV OF P. BOD. BURN. 26.83 10.79



TABLE V. BLUE NOMEX FLIGHT COVERALL

IDENTIFICATION	FLUX	TOTAL % B.B.	FLAMING RESULTS			REMARKS
			AFSE	AFPO	AFGL	FFL COL.C
BNFC3263249	4.64	7.5				X
BNFC3263250	8.07	28.8	X			X
BNFC3263251	5.29	20.8	X			X
BNFC3263252	4.49	31.0	X			X
BNFC3263253	5.08	19.5	X			X
BNFC3263254	7.36	49.5	X			X
BNFC3263255	5.85	28.3	X			X
BNFC3263256	7.53	22.5	X			X
BNFC3263257	6.72	28.8	X			X
BNFC3263258	5.66	31.8	X			X
BNFC3263259	9.86	30.0	X			X
BNFC3263260	3.45	4.0				X

AFSE : AFTER FLAMING, SELF-EXTINGUISHED

AFPO : AFTER FLAMING, MANUALLY EXTINGUISHED

AFGL : AFTER GLOW

FFL : FURTHER FLAMING (FROM AFTER GLOW)

COL.C : COLOR CHANGE : BLUE TO BEIGE

NADC-83118-60



Figure 1. Blue Nomex Flight Coverall (front, before)

NADC-83118-60



Figure 2. Blue Nomex Flight Coverall (front, after)

NADC-83118-60



Figure 3. Blue Nomex Flight Coverall (back, before)

NADC-83118-60



Figure 4. Blue Nomex Flight Coverall (back, after)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Dr. E. Hendler ..... Naval Air Development Center Code 60B1 Warminster, PA 18974	(1)
National Defense Headquarters ..... ATTN: DPM 101 Colonel By Drive Ottawa, Ontario K1A 0K2 Canada	(1)
Colonel Stanley C. Knapp ..... United States Central Command CCSG MacDill AFB, FL 33608	(1)
Staff Officer ..... Aerospace Medicine RAF Staff British Embassy 3100 Massachusetts Avenue, NW Washington, DC 20008	(1)
Commanding Officer ..... 404 Maritime Training Squadron Canadian Forces Base, Greenwood ATTN: Aeromedical Training Unit WO P Handy or Capt. S. Olsen Greenwood, NS bop 1NO Canada	(1)
Canadian Forces Medical Liaison Officer ..... Canadian Defense Liaison Staff 2450 Massachusetts Avenue, NW Washington, DC 20008	(1)
Canadian Airline Pilot's Association ..... Maj. J. Soutendam (Ret) 1300 Steeles Avenue East Brampton, Ontario L6T 1A2 Canada	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Librarian ..... Engineering Research Division IIT Research Institute 10 West 35th Street Chicago, IL 60616	(1)
Editor ..... CONSERVATIONIST MAGAZINE Department of Environmental Conservation 50 Wolf Road Albany, NY 12233	(1)
Librarian ..... School of Textiles Library Nelson Hall Box 5006 North Carolina State University Raleigh, NC 27650	(1)
Harry Diamond Laboratories ..... Scientific & Technical Information Offices 2800 Powder Mill Road Adelphi, MD 20783	(1)
FAA Civil Aeromedical Institute ..... ATTN: Library Box 25082 Oklahoma City, OK 73125	(1)
Department of Defense ..... R.A.N. Research Laboratory P. O. Box 706 Darlinghurst, N.S.W. 2010 Australia	(1)
Canadian Society of Aviation Medicine ..... c/o Academy of Medicine, Toronto ATTN: Ms. Carmen King 288 Bloor Street West Toronto, Ontario M5S 1V8 Canada	(1)
Commanding Officer ..... School of Opnl. & Aerospace Medicine DCIEM P.O. Box 2000 1133 Sheppard Avenue West Downsview, Ontario M3M 3B9 Canada	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

No. of Copies

Research & Development Section .....	
Memphis Fire Department	
79 South Flicker	
Memphis, TN 38104	
Manager .....	(1)
Thermal Garments Division	
Diving Unlimited International	
1148 Delevan Drive	
San Diego, CA 92123	
Manager .....	(1)
Industrial & Fire Safety	
Code DS-3	
NASA Headquarters	
Washington, DC 20546	
Director .....	(1)
School of Textile Engineering	
Georgia Institute of Technology	
Atlanta, GA 30332	
Sirrine Library .....	(1)
111 Sirrine Hall	
College of Ind. Management & Textile Science	
Clemson University	
Clemson, SC 29631	
Chairman .....	(1)
Textile Sciences Department	
Southeastern Massachusetts University	
North Dartmouth, MA 02747	
Brookhaven National Laboratory .....	(1)
Safety & Environmental Protection Division	
Building 50	
ATTN: Fire Protection Group	
Upton, NY 11973	
Chief, Protective Equipment Section .....	(1)
Control Technology Research Branch	
Division of Physical Sciences & Engineering	
National Institute for Occupational Safety & Health	
4676 Columbia Parkway	
Cincinnati, OH 45226	



# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

## MISC.

No. of Copies

Federal Aviation Administration Civil Aeromedical Institute Oklahoma City, OK 73125	(1)
Commandant ..... United States Coast Guard (G-OSR-4) Washington, DC 20590	(1)
Librarian ..... Roger Milliken Textile Library Institute of Textile Technology P. O. Box 391 Charlottesville, VA 22902	(1)
Director ..... Stores & Clothing Research & Development Establishment Ministry of Defense Flagstaff Road Colchester CO2 7SS Essex, England	(1)
Librarian Assistant ..... Institute of Safety & Systems Management Library, SSM 105 University of Southern California Los Angeles, CA 90007	(1)
Chairman ..... Department of Textiles & Consume Economics College of Human Ecology University of Maryland College Park, MD 20742	(1)
The Librarian ..... CSIRO Division of Textile Physics 338 Blaxland Road Ryde, N.S.W., Australia 2112	(1)
Dr. A. Bendak ..... Professor Associate National Research Centre Textile Research Labs Dokki, Cairo, Egypt	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Director ..... United States Army Human Engineering Laboratory ATTN: Technical Library Aberdeen Proving Ground, MD 21005	(1)
Commander ..... United States Army Aviation Research & Development Command ATTN: Library 4300 Goodfellow Blvd. St. Louis, MO 63166	(1)
Commandant ..... United States Army Academy of Health Sciences ATTN: Library Fort Sam Houston, TX 78234	(1)
Commander ..... United States Army Airmobility Laboratory ATTN: Library Fort Eustis, VA 23604	(1)
Air University Library ..... (AUL/LSE) Maxwell Air Force Base, AL 36112	(1)

## DEFENSE

Director ..... Defense Technical Information Center Building 5 Cameron Station Alexandria, VA 22314	(12)
National Library of Medicine ..... Bethesda, MD 20014	(1)
Under Secretary of Defense for Research & Engineering ..... ATTN: Military Assistant for Medical & Life Sciences Washington, DC 20301	(1)
Uniformed Services University of the Health Sciences ..... 4301 Jones Bridge Road Bethesda, MD 20014	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
United States Army ..... Foreign Science & Technology Center ATTN: DRXST-IS1 220 7th Street, NE Charlottesville, VA 22901	(1)
Commander ..... United States Army Training & Doctrine Command ATTN: ATCD Fort Monroe, VA 23651	(2)
Commander ..... United States Army Training & Doctrine Command ATTN: Surgeon Fort Monroe, VA 23651	(1)
United States Army ..... Research & Technology Labs Structures Laboratory Library NASA Langley Research Center Mail Stop 266 Hampton, VA 23665	(1)
Commander ..... United States Army Natick Research & Development Laboratories ATTN: Technical Librarian Natick, MA 01760	(1)
Commander ..... United States Army Transportation School ATTN: ATSP-TD-ST Fort Eustis, VA 23604	(1)
Commander ..... United States Army Troop Support & Aviation Material Readiness Command ATTN: DRSTS-W St. Louis, MO 63102	(1)
Commander ..... United States Army Aviation Research & Development Command ATTN: DRDAV-E 4300 Goodfellow Blvd. St. Louis, MO 63166	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
United States Army ..... Research & Development Technical Support Activity Fort Monmouth, NJ 07703	(1)
United States Army ..... Avionics Research & Development Activity ATTN: DAVAA-O Fort Monmouth, NJ 07703	
United States Army ..... White Sands Missile Range Technical Library Division White Sands Missile Range, NM 88002	(1)
Chief ..... Benet Weapons Laboratory LCWSL, USA ARRADCOM ATTN: DRDAR-LCB-TL Watervliet Arsenal Watervliet, NY 12189	(1)
Commander ..... USAARL SGRD-UAB-CB ATTN: Dr. F. Knox P. O. Box 577 Fort Rucker, AL 36362	(1)
United States Army ..... Field Artillery School Library Snow Hall, Room 16 Fort Sill, OK 73503	(1)
United States Army ..... Army Dugway Proving Ground Technical Library Bldg. 5330 Dugway, UT 84022	(1)
United States Army ..... Material Development & Readiness Command ATTN: DRCSG 5001 Eisenhower Avenue Alexandria, VA 22333	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Headquarters ..... United States Army Combat Developments Experimentation Command Technical Library Box 22 Fort Ord, CA 93941	(1)
United States Army ..... Research & Technology Laboratory Aeromechanics Laboratory Ames Research Center M/S 215-1 Moffett Field, CA 94035	(1)
Sixth United States Army ..... ATTN: SMA Presidio of San Francisco San Francisco, CA 94129	(1)
United States Army ..... Ordnance Center & School Library, Bldg. 3071 ATTN: ATSL-DOSL Aberdeen Proving Ground, MD 20015	(1)
United States Army ..... Environmental Hygiene Agency Library, Bldg. E2100 Aberdeen Proving Ground, MD 21010	(1)
Technical Library ..... Chemical Systems Laboratory Aberdeen Proving Ground, MD 21010	(1)
United States Army ..... Material Systems Analysis Agency ATTN: Reports Distribution Aberdeen Proving Ground, MD 21005	(1)
Commander ..... United States Army Medical Research Institute of Chemical Defense Aberdeen Proving Ground, MD 21010	(1)
Director ..... Ballistic Research Laboratory ATTN: DRDAR-TSB-S (STINFO) Aberdeen Proving Ground, MD 21005	(2)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Commander ..... United States Army Natick Research and Development Center ATTN: STRNC-ICC Charles Williams IPL-Chemical Protection Section Kansas Street Natick, MA 01760	(1)
Commander ..... United States Army Research Institute of Environmental Medicine (SGRD-UE-PH) United States Army Natick Research & Development Command Natick, MA 01760	(1)
Commanding General ..... United States Army Material Development & Readiness Command (DRCDE-DS-T) 5001 Eisenhower Avenue Alexandria, VA 22333	(1)
Commander ..... United States Army Medical Research & Development Command ATTN: SGRD-RMS/Ms. Madigan Fort Detrick Frederick, MD 21701	(5)
Redstone Scientific Information Center ..... United States Army Missile Research & Development Command ATTN: DRDMI-TBD Redstone Arsenal, AL 35809	(1)
United States Army ..... Yuma Proving Ground Technical Library Yuma, AZ 85634	(1)
United States Army ..... Aviation Engineering Flight Activity ATTN: DAVTE-M (Technical Library) Edwards Air Force Base, CA 93523	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
United States Air Force ..... CAPT Linda Darrien Wright-Patterson AFB, OH 45433	(1)
United States Air Force ..... Artic Aeromedical Laboratory Librarian APO Seattle, WA	(1)
Air Force Aerospace Medical Research Laboratory ..... Human Engineering Division ATTN: Technical Librarian Wright-Patterson AFB, OH 45433	(1)

## ARMY

United States Army ..... Armament & Development Command (DRDAR-CLJ-1/Tech. Library) Aberdeen Proving Ground, MD 12005	(2)
United States Army ..... Medical Research & Development Command Walter Reed Army Medical Center 6825 16th Street NW (MEDDH-SI) Washington, DC 20012	(1)
Commanding Officer ..... United States Army Research Institute of Environmental Medicine (ARIEM) Natick, MA 01760	(2)
Director ..... Army Armament Research & Development Command PLASTEC (Library: DRDAR-LCA-OK) Dover, NJ 07801	(1)
Commander ..... United States Army Natick Research & Development Command (DRDNA-TRL) Natick, MA 01760	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Air University Library ..... Maxwell Air Force Base Montgomery, AL 36112	(1)
Air Force Systems Command ..... (SCBB) Andrews Air Force Base Washington, DC 20334	(1)
United States Air Force ..... Flight Test Center (FTDT) Edwards AFB, CA 93523	(1)
Headquarters ..... TAC/SGPA Langley Air Force Base Hampton, VA 23665	(1)
Division of Aerospace Pathology ..... Washington, DC	(1)
United States Air Force ..... Flight Test Center Technical Library Stop 238 Edwards AFB, CA 93523	(1)
United States Air Force ..... Armament Development & Test Center Technical Library Eglin AFB, FL 32542	(1)
United States Air Force ..... Institute of Technology (AFIT/LDE) Bldg. 640, Area B Wright-Patterson AFB, OH 45433	(1)
United States Air Force ..... School of Aerospace Medicine Aerospace Medical Division Aeromedical Library/TSK-4 Brooks AFB, TX 78235	(1)
Director of Professional Services ..... Office of the Surgeon General Department of the Air Force Washington, DC 20314	(1)



# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
United States Navy .....	(2)
Naval Aerospace Medical Institute Library	
Bldg. 1953, Code 012	
Pensacola, FL 32508	
United States Navy .....	(2)
Naval Submarine Medical Research Laboratory	
Medical Library	
Naval Submarine Base	
Box 900	
Groton, CT 06340	
CAPT. J. R. Sheetz .....	
CPS Rm. 736	
Crystal City	
Washington, DC 20360	
United States Navy .....	(2)
Liaison Officer	
Federal Aviation Administration	
(Medical Library HQ-640)	
800 Independence Ave., SW	
Washington, DC 20591	
Commander .....	(6)
Naval Air Development Center	
ATTN: Code 60B1 (Dr. George H. Kydd)	
Warminster, PA 18974	

## AIR FORCE

6570 AMRL/DAL Library .....	(1)
Wright-Patterson AFB, OH 45433	
Headquarters .....	(1)
United States Air Force	
Directorate of Operations	
(AFRSTA)	
DCS/R&D	
Washington, DC 20330	
United States Air Force .....	(1)
School of Aerospace Medicine	
(TSK-4, Library)	
Brooks Air Force Base, TX 78362	

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Naval Air Systems Command . . . . . Technical Library (AIR 9500) Rm. 278 Jefferson Plaza II Department of the Navy Washington, DC 20361	(1)
United States Navy . . . . . Naval Research Laboratory Library Code 1433 Washington, DC 20375	(1)
United States Navy . . . . . Naval Air Development Center Code 8131 Technical Information Division Technical Support Department Warminster, PA 18974	(3)
Naval Air Development Center . . . . . Human Factors Engineering Division Aircraft & Crew Systems Technology Directorate Warminster, PA 18974	(1)
United States Navy . . . . . Naval Research Laboratory Library Shock & Vibration Information Center Code 8404 Washington, DC 20375	(1)
Office of Naval Research . . . . . Director of Biological & Medical Sciences Division 800 N. Quincy Street Arlington, VA 22217	(1)
Commanding Officer . . . . . Naval Medical Research & Development Command National Naval Medical Center Bethesda, MD 20014	(1)
Commanding Officer . . . . . Naval Biodynamics Laboratory P. O. Box 29407 New Orleans, LA 70189	(1)
United States Navy . . . . . Naval Weapons Center Technical Library Division Code 2333 China Lake, CA 93555	(1)

# DISTRIBUTION LIST CONTINUED

REPORT NO. NADC-83118-60

	No. of Copies
Commanding Officer ..... Naval Submarine Medical Research Laboratory P. O. Box 900 Naval Base Groton, CT 06320	(1)
Commander ..... Naval Safety Center Naval Air Station Norfolk, VA 23511 (1 for Code 055) (1 for Code 40)	(2)
Commanding Officer ..... Naval Construction Battalion Center Code 1573 Port Hueneme, CA 93043	(1)
Chief of Naval Material ..... Department of the Navy Washington, DC 20360 (1 for MAT 04F) (1 for MAT 08T24D)	(2)
Director ..... Naval Research Laboratory Code 6130: DDW Washington, DC 20375	(1)
Commander ..... Naval Supply Systems Command (SUP 09B) Department of the Navy Washington, DC 20376	(1)
Commanding Officer ..... Naval Explosive Ordnance Disposal Facility Code 50 Indian Head, MD 20640	(1)
Commanding Officer ..... Naval Medical Research Institute National Naval Medical Center (Heat Stress Division) Bethesda, MD 20014	(1)
Director ..... Naval Biosciences Laboratory Naval Supply Center Bldg. 844 Oakland, CA 94625	(1)

**END**

**FILMED**

**4-85**

**DTIC**